

Service Bulletin

S&T MOTORS CO., LTD.

-----#77, SUNGSAN-DONG, CHANGWON-CITY,KYUNGNAM,KOREA Tel.82-55-276-7385,Fax.82-55-274-0585-----

ISSUE NO. : 09-003	DATE : 4th Mar. 2009	PAGES : 1 OF 2
--------------------	----------------------	----------------

SUBJECT	Tensioner, Adjuster improvement	
MODEL	GT/GV-125/250	
EFFECTIVE F/M NO		

This service bulletin is written to inform you that Tensioner, Adjuster got improvements

1. Trouble Cause

- 1) Tensioner, Adjuster got incorrect working very often and affect engine damages.
-> Being pushed to backward of Tensioner, Adjuster on driving.

2. Countermeasure

- 1) Screw specification has modified.



Tr8*L5-3W



Tr8*L3-2W

- 2) The Shape of Tab-end re-formed. (plane shape -> curved shape)



- 3) Spring inside became thicker.(4mm -> 4.5mm)



Service Bulletin

S&T MOTORS CO., LTD.

-----#77, SUNGSAN-DONG, CHANGWON-CITY,KYUNGNAM,KOREA Tel.82-55-276-7385,Fax.82-55-274-0585-----

ISSUE NO. : 09-003

DATE : 4th Mar. 2009

PAGES : 2 OF 2

SUBJECT	Tensioner, Adjuster improvement	
MODEL	GT/GV-125/250	
EFFECTIVE F/M NO		

This service bulletin is written to inform you that Tensioner, Adjuster got improvements

3. Marking on products



Marked as " S oooo 83W "

lot No.

4. Apply date

- 1) It's schedule to apply for Products from early in March 2009.
- 2) The effective engine No. will be informed to you late on.

5. Action for Market : Carry out Service Campaign

- 1) Supplying Improvement Parts : Schedule to spread from early in March 2009.
- 2) We allow that the labor time for the repare is 0.3Hr/EA .
- 3) For applying this work to on Warranty Claim form, The Qty' must be "0" and marked as "Campaign" in "Claim Category".

6. The Engine No.s of Bikes applying to Service Campaign

Model	ENGINE No.	Vin No.
GT250	112340 ~ 122141	KM4MJ51E471103672 ~ KM4MJ51E681107630
GT125	110594 ~ 114862	KM4MF52C571500001 ~ KM4MF52B481501102
GV250	124422 ~ 128992	KM4MJ525471213961 ~ KM4MJ52A981100649
GV125	121550 ~ 124658	KM4MF52A471500120 ~ KM4MF52A881502440

- The End -